

INDEPENDENT INSPECTION REPORT

Anonymised example. Identities removed, mileage rounded and private documents excluded.

Peugeot 2008

Approx. 121.000 km · October 2026

Inspected by Carvise · Reviewed by Carvise

Vehicle and seller

Category

City / compact

Declared mileage

Approx. 120.000 km

Observed mileage

Approx. 121.000 km

Reviewed by

Carvise



Photo 10 — Front bumper

The Carvise assessment

Overall condition

1/5



Purchase not recommended

The vehicle is in poor condition considering its age and mileage. It shows clear signs of inadequate maintenance and care. A budget should be set aside for the repairs needed to make it reliable and pass the technical inspection.

Our recommendations

Two essential points:

1. Replace the timing belt and carry out a full service with fresh fluids to establish a sound maintenance baseline.
2. Before the technical inspection, address at least the identified problems with the dipped headlights, registration plate lights, reversing lights and front fog lights.

128/145

points inspected

17

defects identified

9

to monitor

44

photographs

Your inspection in detail

All checks are grouped by category. Observations, measurements and photographs explain the findings.

Vehicle and seller		1
The Carvise assessment		2
01 Documents and service	14 checks	4
02 Vehicle characteristics	16 checks	6
03 Engine bay & mechanics	13 checks	9
04 Body & paint	24 checks	13
05 Lighting	11 checks	22
06 Tyres, wheels & brakes	13 checks	24
07 Interior	18 checks	30
08 Equipment & comfort	16 checks	34
09 Stationary test	6 checks	36
10 Road test	13 checks	37
11 OBD diagnostics	1 checks	38
Defects and points to monitor		39

01 Documents and service

14 checks

Registration certificate	Checked · OK
VIN matches registration	Checked · OK
Plate matches registration	Not applicable

OBSERVATION

The vehicle is not registered.

Seller is the owner	Not applicable
Service book	Defect observed

OBSERVATION

No service history.

Service invoices	Defect observed
------------------	-----------------

OBSERVATION

The seller has no invoices.

Last service date	Defect observed
-------------------	-----------------

OBSERVATION

Worn engine belt.

RECOMMENDATION

Replace as soon as possible and carry out a full service.

Mileage at last service	Defect observed
-------------------------	-----------------

OBSERVATION

No history available.

Documents and service · continued

Technical inspection

Defect observed

OBSERVATION

The technical inspection is not up to date.

Car-Pass / Status certificate

Defect observed

OBSERVATION

There are gaps in the mileage history, suggesting that the vehicle has not undergone a technical inspection for several years.

Certificate of conformity (COC)

Checked · OK

Owner's manual

Checked · OK

Manufacturer warranty

Not applicable

Number of keys

Monitor

OBSERVATION

The seller has only one key, with no spare.

02 Vehicle characteristics

16 checks

Exterior colour

Checked · OK

OBSERVATION

Black

Interior colour

Checked · OK

OBSERVATION

Black

Number of doors

Checked · OK

OBSERVATION

4

Number of seats

Checked · OK

OBSERVATION

5

Fuel type

Checked · OK

OBSERVATION

Petrol

Engine displacement (cc)

Checked · OK

OBSERVATION

1199

Power (kW / hp)

Checked · OK

OBSERVATION

60 kW / 80 hp

Vehicle characteristics · continued

Emission standard (Euro)

Checked · OK

OBSERVATION

6b

Gearbox type

Checked · OK

OBSERVATION

Manual

Number of gears (excl. reverse)

Checked · OK

OBSERVATION

5 gears

Reverse gear present

Checked · OK

Drivetrain

Checked · OK

OBSERVATION

Front-wheel drive

Observed mileage

Checked · OK

OBSERVATION

Approximately 121,000 km (rounded for this example).

Vehicle characteristics · continued



Photo 1 — Observed mileage

Mileage coherent with exterior	Checked · OK
Mileage coherent with interior	Checked · OK
Mileage coherent with service history	Defect observed

OBSERVATION

Without a service history, it is not possible to assess precisely whether the vehicle’s condition is consistent with its maintenance record.

03 Engine bay & mechanics

13 checks

Engine oil level

Defect observed

OBSERVATION

Oil level below the minimum.

RECOMMENDATION

Service required.

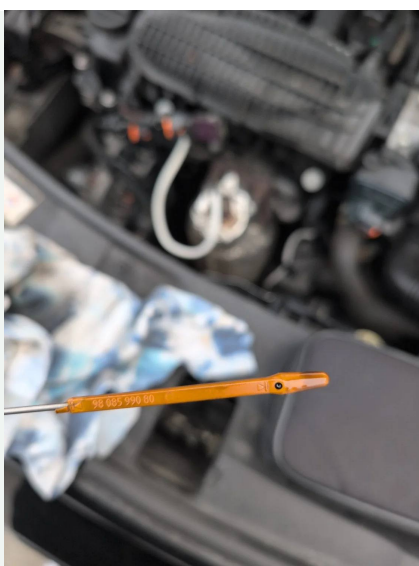


Photo 2 — Engine oil level

Coolant

Defect observed

OBSERVATION

Coolant diluted and below the minimum level.

RECOMMENDATION

Top up with undiluted coolant.

Engine bay & mechanics · continued



Photo 3 — Coolant



Photo 4 — Coolant

Brake fluid

Checked · OK

OBSERVATION

Quality and moisture content are satisfactory.



Photo 5 — Brake fluid

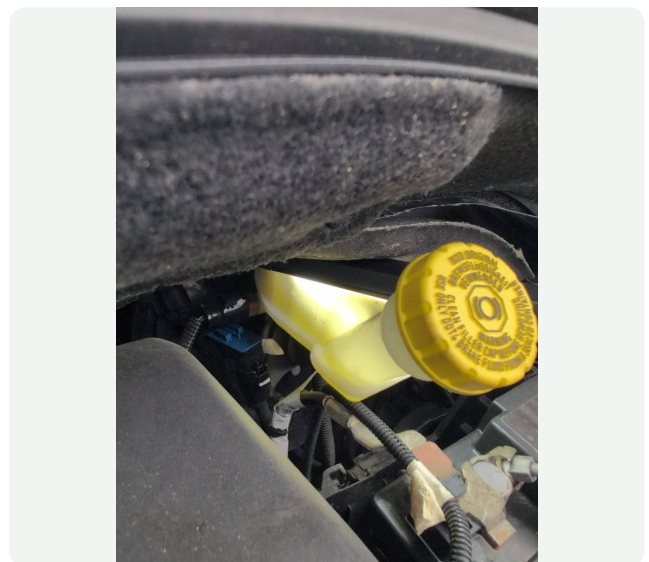


Photo 6 — Brake fluid

Engine bay & mechanics · continued

Power steering fluid

Not applicable

OBSERVATION

Electric power steering.

Washer fluid

Defect observed

OBSERVATION

Reservoir empty.

RECOMMENDATION

Top up.

Engine bay cleanliness

Checked · OK

RECOMMENDATION

Secure the protective cover correctly.

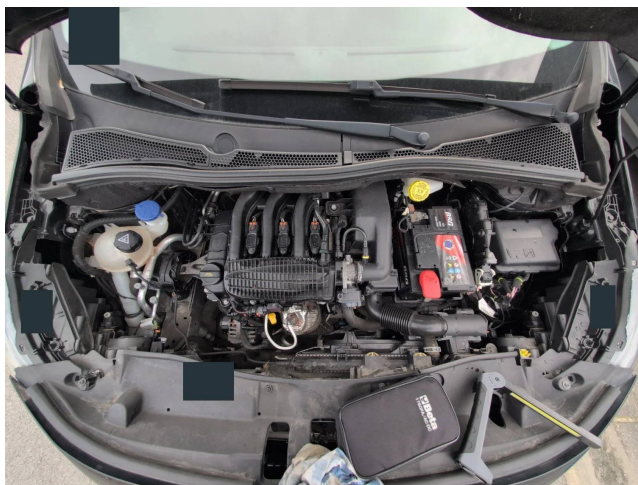


Photo 7 — Engine bay cleanliness

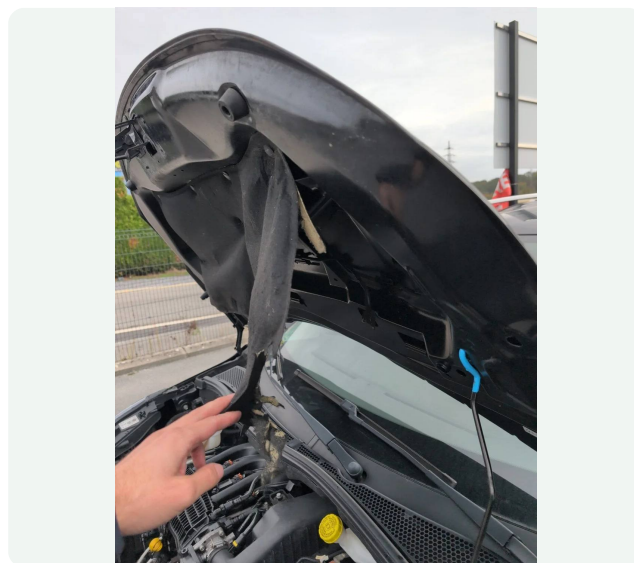


Photo 8 — Engine bay cleanliness

Engine hoses

Checked · OK

Accessory belt

Checked · OK

Engine bay & mechanics · continued

Battery

Checked · OK

OBSERVATION

Refer to the battery test in the original dossier. This attachment is not included in the public example.

Alternator

Checked · OK

OBSERVATION

14.6 V

Starter motor

Checked · OK

Exhaust

Checked · OK

Visible leaks

Monitor

OBSERVATION

Oily traces on the engine.

RECOMMENDATION

Possible leak at the valve cover gasket or an engine seal.

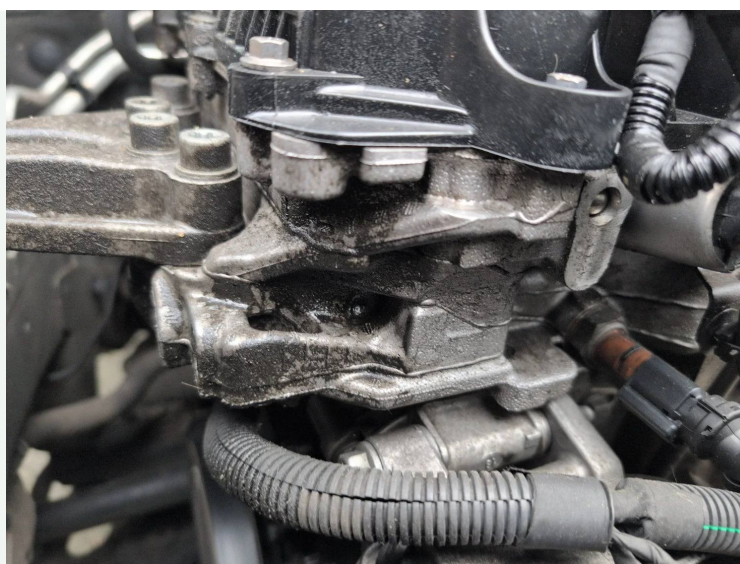


Photo 9 — Visible leaks

04 Body & paint

24 checks

Front bumper

Checked · OK

Photo 10 · page 1

Rear bumper

Monitor

OBSERVATION

Discoloured bumper.

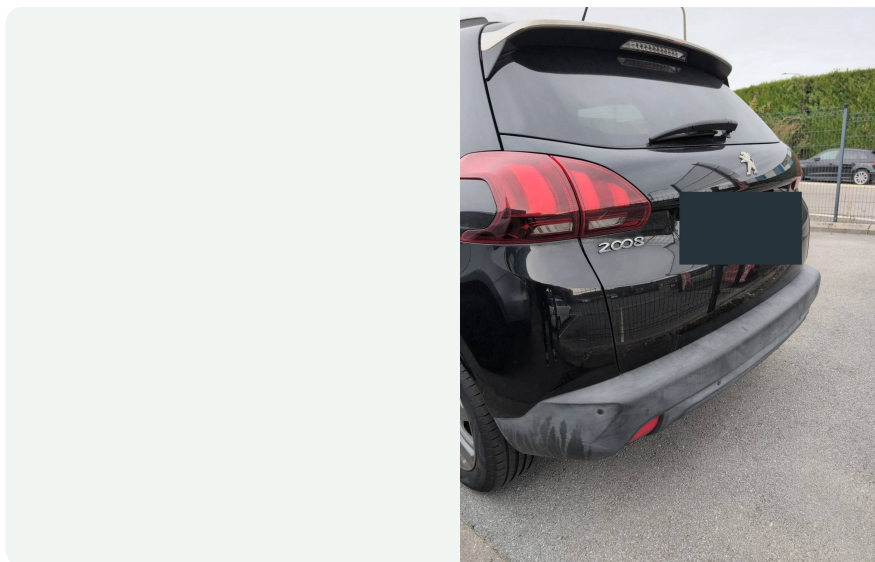


Photo 11 — Rear bumper

Hood

Checked · OK

OBSERVATION

Visible scratches with paint and clear coat removed.

Body & paint · continued



Photo 12 — Hood



Photo 13 — Hood

Roof

Checked · OK

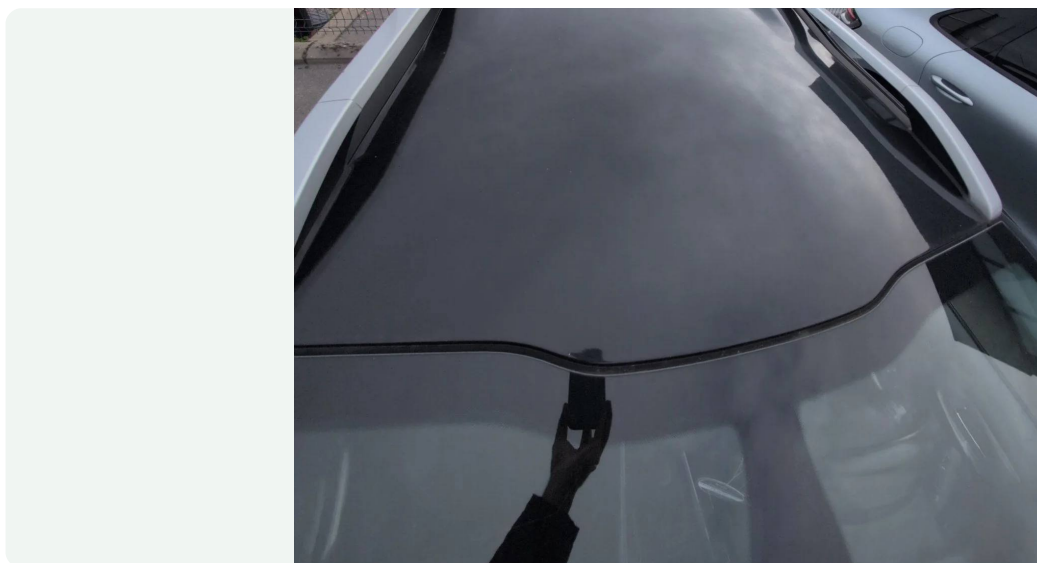


Photo 14 — Roof

Tailgate / trunk

Checked · OK

Body & paint · continued



Photo 15 — Tailgate / trunk

Front left fender

Checked · OK

Front right fender

Defect observed

OBSERVATION

Scratches and a dent.

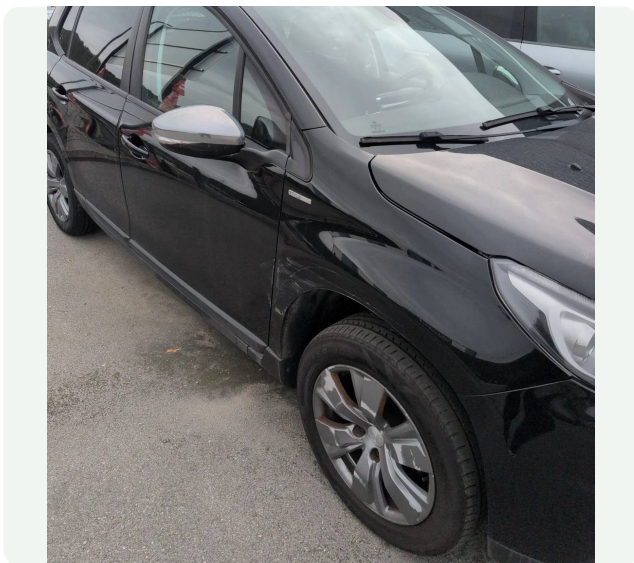


Photo 16 — Front right fender



Photo 17 — Front right fender

Body & paint · continued

Rear left quarter panel

Checked · OK

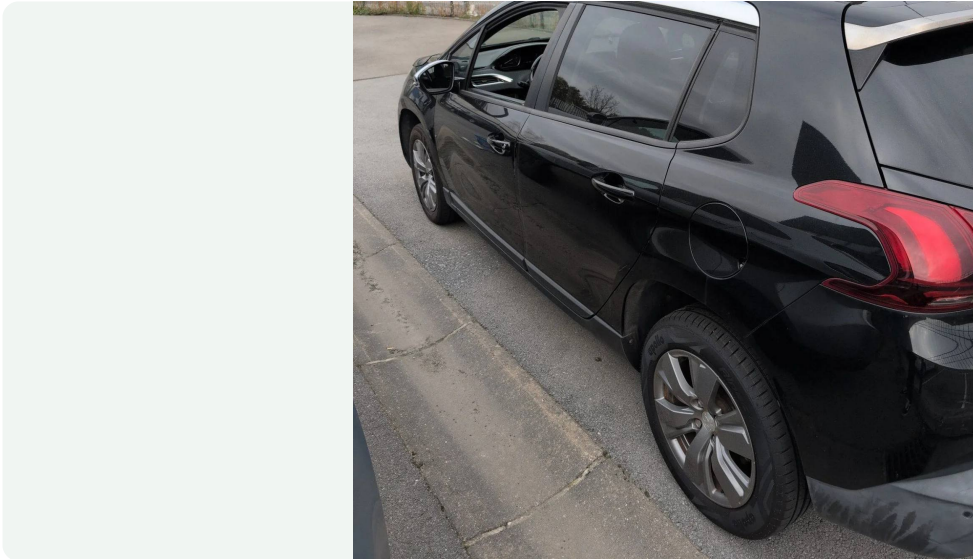


Photo 18 — Rear left quarter panel

Rear right quarter panel

Checked · OK

Left doors

Checked · OK

OBSERVATION

Some scratches.

Body & paint · continued



Photo 21 — Left doors



Photo 22 — Left doors

Right doors

Checked · OK



Photo 19 — Right doors

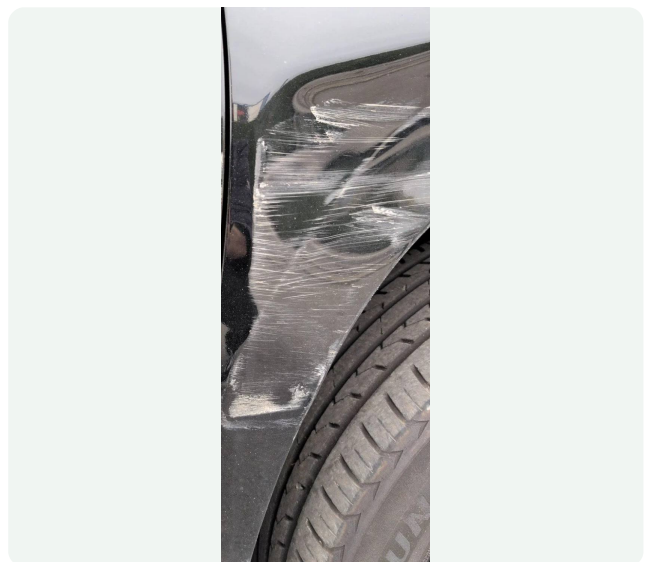


Photo 20 — Right doors

Left rocker panel

Checked · OK

Right rocker panel

Checked · OK

Body & paint · continued

Left mirror

Checked · OK

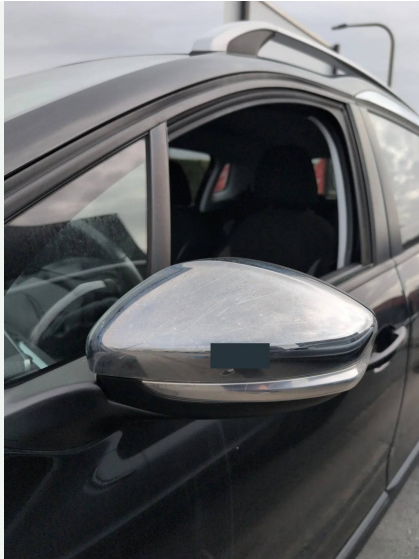


Photo 24 — Left mirror

Right mirror

Monitor

OBSERVATION

Broken indicator lens.



Photo 23 — Right mirror

Body & paint · continued

Windshield	Checked · OK
Rear window	Checked · OK
Front wipers	Checked · OK
Rear wiper	Checked · OK
Body seals	Monitor

OBSERVATION

Torn seal on the passenger side.

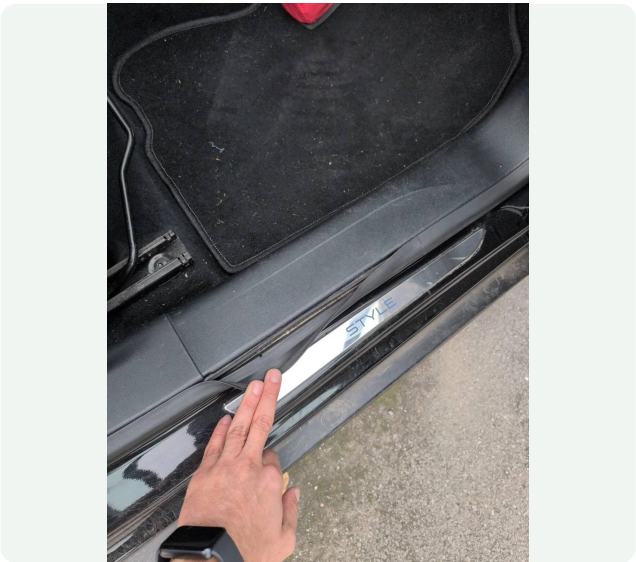


Photo 25 — Body seals

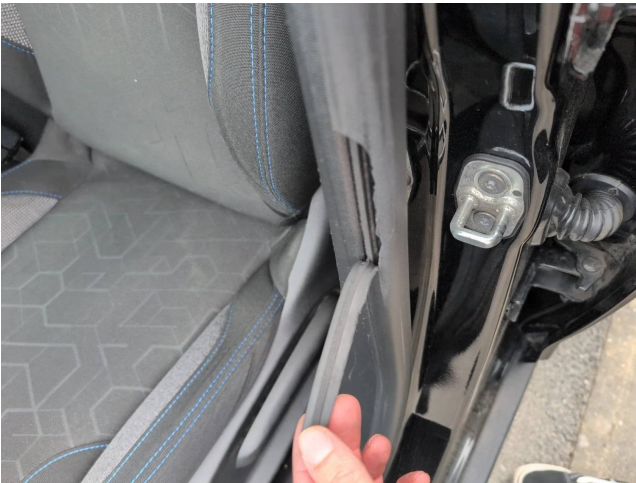


Photo 26 — Body seals

Body & paint · continued



Photo 27 — Body seals

Panel alignment

Defect observed

OBSERVATION

The bonnet, wings and front bumper are misaligned, strongly suggesting an impact.



Photo 28 — Panel alignment



Photo 29 — Panel alignment

Body & paint · continued

Paint uniformity

Monitor

OBSERVATION

A repair mark is visible on the tailgate. No signs of serious damage were identified in that area.

Repair traces

Monitor

OBSERVATION

Mark identified on the right-hand side of the tailgate.

Corrosion

Checked · OK

05 Lighting

11 checks

Position lights	Checked · OK
Daytime running lights (DRL)	Checked · OK
Low beam	Defect observed

OBSERVATION

Does not work.

High beam	Checked · OK
Front indicators	Checked · OK
Rear indicators	Checked · OK
Brake lights	Checked · OK
Reverse lights	Defect observed

OBSERVATION

Do not work.

Fog lights	Defect observed
------------	-----------------

OBSERVATION

Left fog light missing.

Lighting · continued



Photo 30 — Fog lights

Plate lights

Defect observed

OBSERVATION

Do not work.

Interior lights

Checked · OK

06 Tyres, wheels & brakes

13 checks

Front left tyre

Checked · OK

OBSERVATION

Estimated remaining tread depth: 10%.

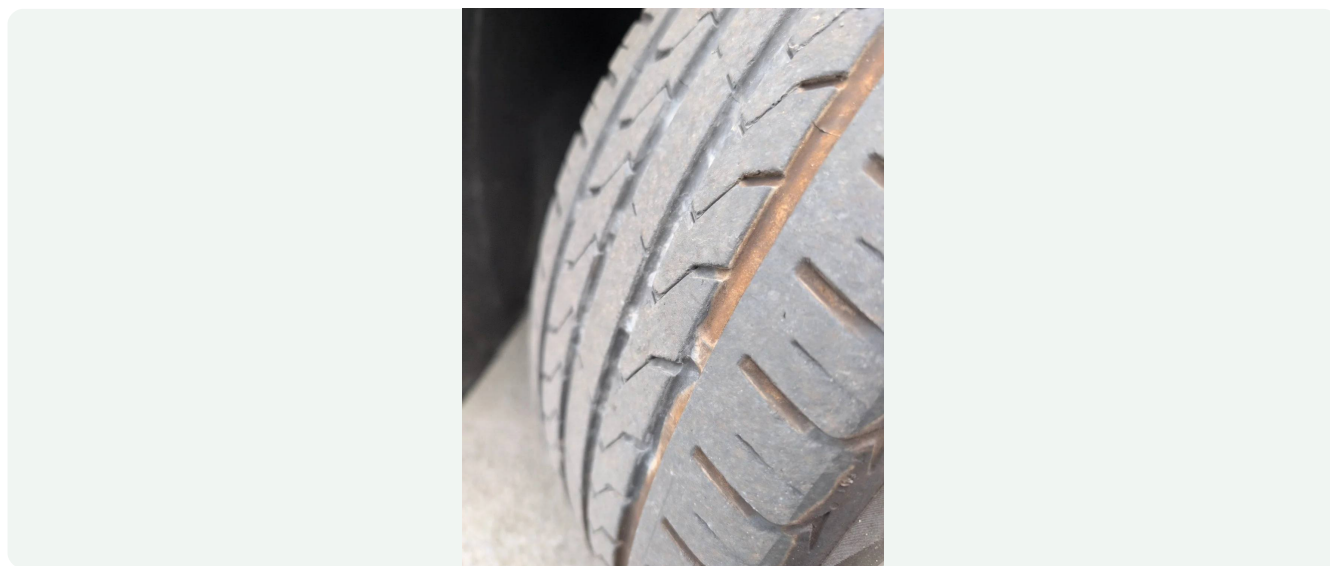


Photo 31 — Front left tyre

Front right tyre

Checked · OK

Tyres, wheels & brakes · continued

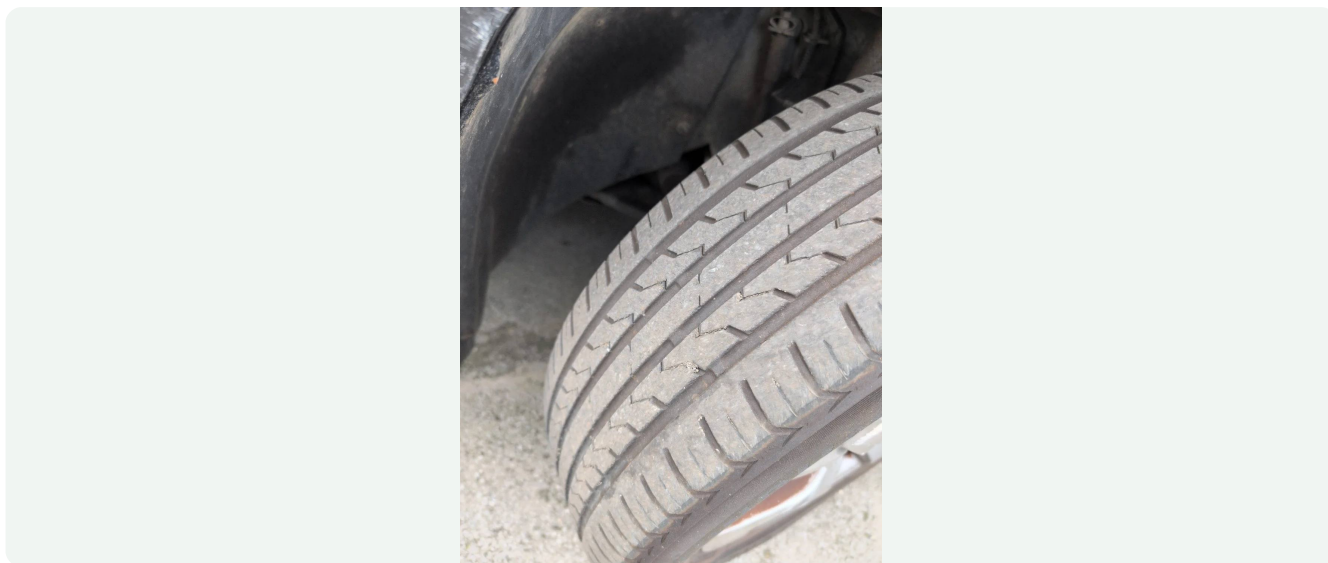


Photo 32 — Front right tyre

Rear left tyre

Checked · OK

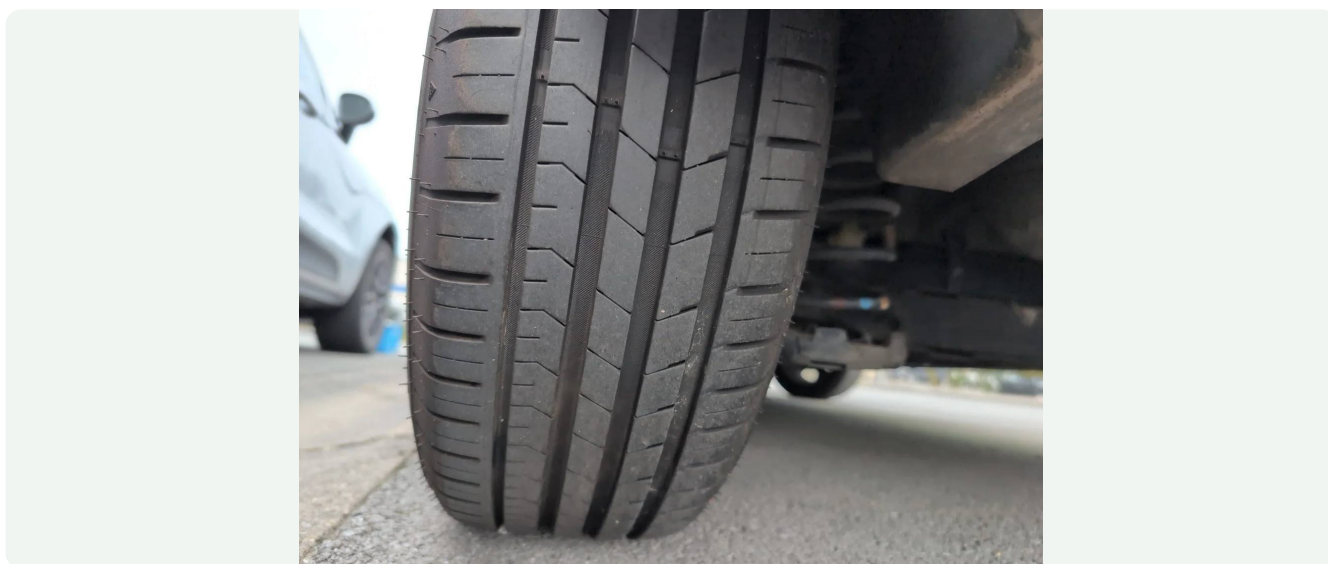


Photo 33 — Rear left tyre

Rear right tyre

Checked · OK

Tyres, wheels & brakes · continued

Front left wheel

Checked · OK

OBSERVATION

Some impact marks.



Photo 34 — Front left wheel

Front right wheel

Checked · OK

OBSERVATION

Heavily marked wheel rim.

Tyres, wheels & brakes · continued

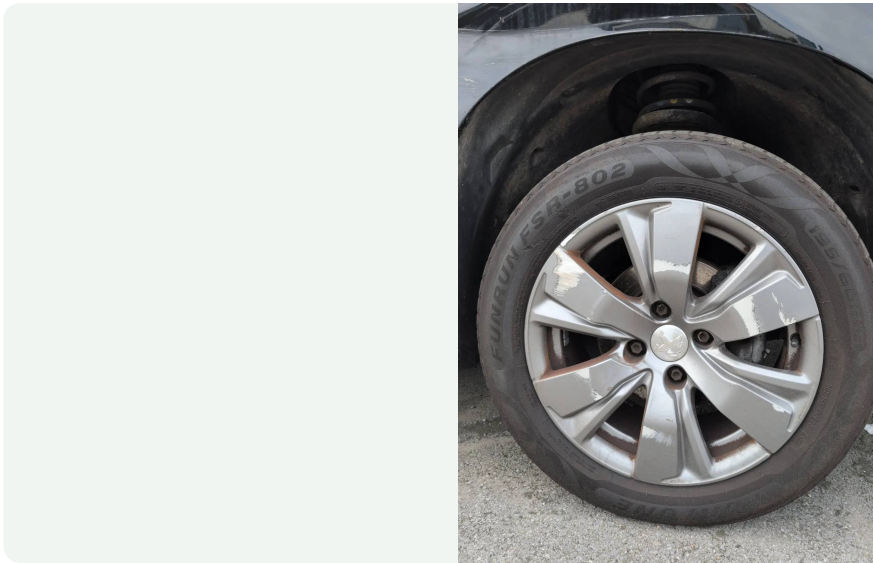


Photo 35 — Front right wheel

Rear left wheel

Checked · OK

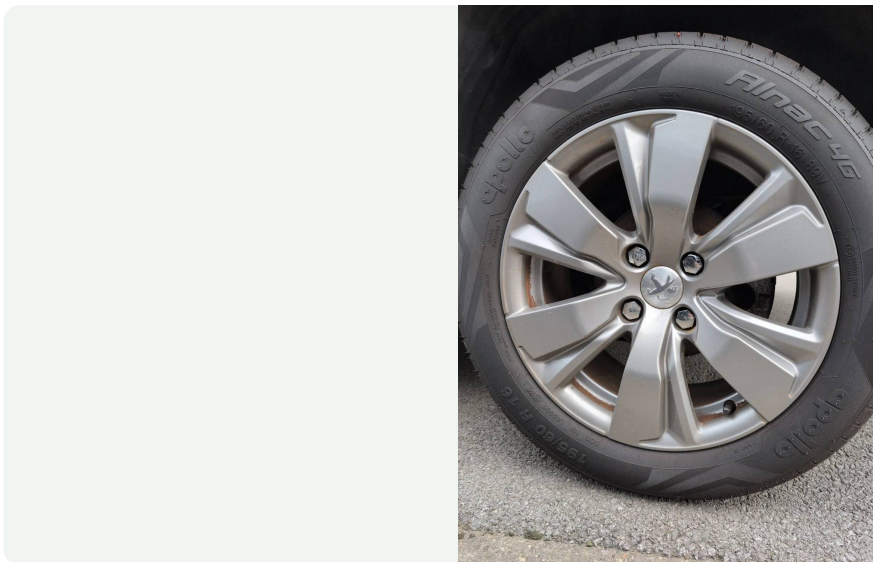


Photo 37 — Rear left wheel

Rear right wheel

Checked · OK

Tyres, wheels & brakes · continued



Photo 36 — Rear right wheel

Front brake pads	Checked · OK
------------------	--------------

OBSERVATION

Estimated remaining thickness: 70%.

Front brake discs	Checked · OK
-------------------	--------------

Rear brake pads	Monitor
-----------------	---------

OBSERVATION

Estimated remaining thickness: 10%.

Rear brake discs	Checked · OK
------------------	--------------

Spare wheel / kit	Checked · OK
-------------------	--------------

Tyres, wheels & brakes · continued

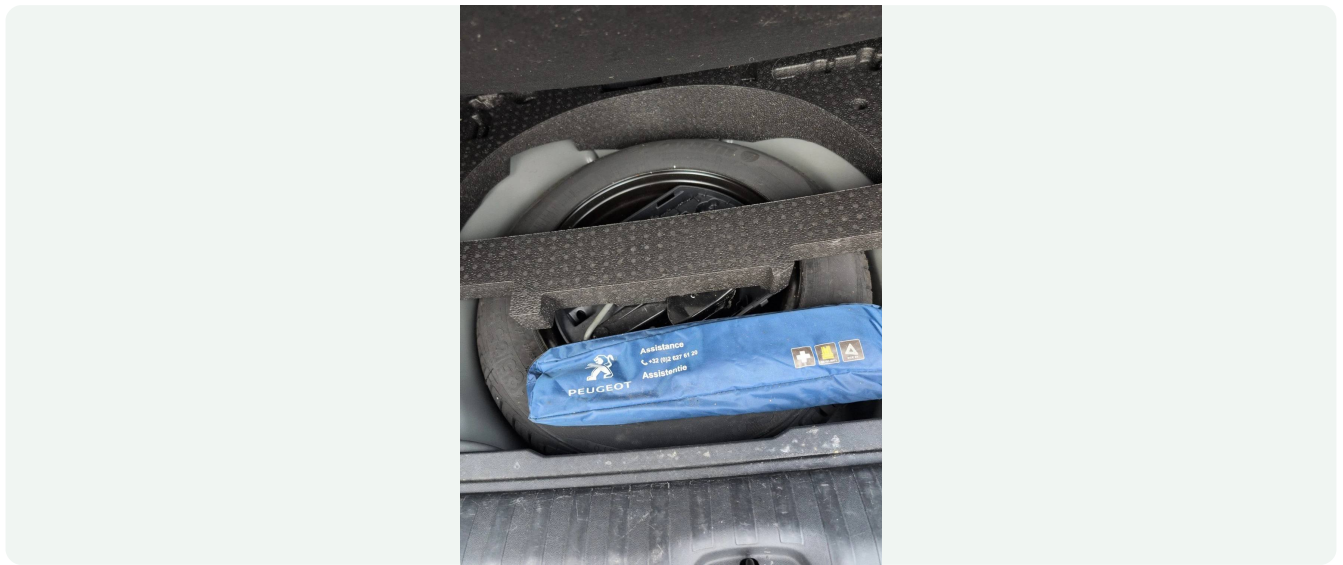


Photo 38 — Spare wheel / kit

07 Interior

18 checks

Steering wheel	Checked · OK
Dashboard	Checked · OK
Center console	Checked · OK
Infotainment screen	Checked · OK



Photo 39 — Infotainment screen

Front seats	Checked · OK
Rear seats	Checked · OK
Front door panels	Checked · OK

Interior · continued



Photo 40 — Front door panels

Rear door panels	Checked · OK
Headliner	Checked · OK
Carpets and mats	Monitor

OBSERVATION
Torn driver's floor mat.

Interior · continued



Photo 41 — Carpets and mats



Photo 42 — Carpets and mats

Trunk interior	Checked · OK
Window switches	Checked · OK
Steering wheel controls	Checked · OK
Front seatbelts	Checked · OK
Rear seatbelts	Checked · OK
Center mirror	Checked · OK
Warning lights	Defect observed

OBSERVATION

Engine and service warning lights illuminated.

RECOMMENDATION

Consult the diagnostic report in the original dossier. This attachment is not included in the public example.

Interior · continued

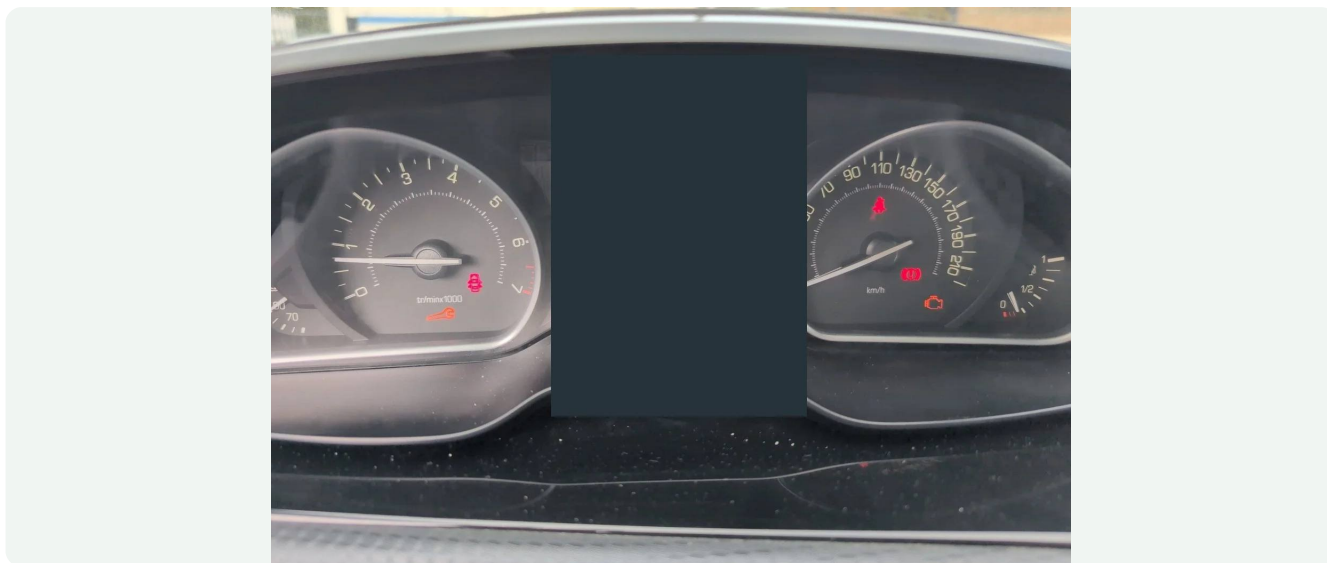


Photo 43 — Warning lights

Odometer

Checked · OK

08 Equipment & comfort

16 checks

Upholstery (leather, fabric, mixed)	Checked · OK
-------------------------------------	--------------

OBSERVATION

Black fabric.

Air conditioning	Checked · OK
Heating	Checked · OK
Heated seats	Not applicable
Electric seats	Not applicable
Electric windows	Checked · OK
Central locking	Checked · OK
Sunroof / convertible roof	Not applicable
Cruise control	Checked · OK
Parking sensors	Checked · OK

Equipment & comfort · continued



Photo 44 — Parking sensors

Reverse camera	Not applicable
Navigation	Checked · OK
Bluetooth / pairing	Checked · OK
Speakers	Checked · OK
Tow hitch	Not applicable
Jack and tools	Checked · OK

09 Stationary test

6 checks

Cold start	Checked · OK
Idle	Checked · OK
Exhaust smoke	Checked · OK
Engine noise	Checked · OK
Horn	Checked · OK
Parking brake	Checked · OK

10 Road test

13 checks

Engine behaviour	Not inspected
Acceleration	Not inspected
Gearbox operation	Checked · OK
Clutch operation	Checked · OK
Differential	Not inspected
Steering / tracking	Not inspected
Braking (effectiveness, ABS)	Checked · OK
Suspension / damping	Not inspected
Wheel alignment	Not inspected
Wheel bearings	Not inspected
Driver assistance (ESP/ABS)	Not inspected
Abnormal noises	Checked · OK
Vibrations	Checked · OK

11 OBD diagnostics

1 checks

Fault code scan

Checked · OK

OBSERVATION

No serious fault codes to report. Almost all messages related to a low battery in the past.

Inspection details

Caution remains necessary regarding the engine's condition. These engines have a history of problems; inadequate maintenance may lead to problems or failures in the medium or long term.

Points to consider

Service book — Defect observed

Service invoices — Defect observed

Last service date — Defect observed

Mileage at last service — Defect observed

Technical inspection — Defect observed

Car-Pass / Status certificate — Defect observed

Mileage coherent with service history — Defect observed

Engine oil level — Defect observed

Coolant — Defect observed

Washer fluid — Defect observed

Front right fender — Defect observed

Panel alignment — Defect observed

Low beam — Defect observed

Reverse lights — Defect observed

Fog lights — Defect observed

Plate lights — Defect observed

Warning lights — Defect observed

Number of keys — Monitor

Visible leaks — Monitor

Rear bumper — Monitor

Right mirror — Monitor

Body seals — Monitor

Paint uniformity — Monitor

Repair traces — Monitor

Rear brake pads — Monitor

Carpets and mats — Monitor